



Incident: MMU#4767, YNP#08-0896 Mariposa County Fire#330, YNP Fire#08-042 April 21, 2008 Structure Fire 'El Portal Market' 10893 Hwy 140, El Portal, CA 95318

- 1. SUMMARY
- 2. VICTIM & WITNESS
- 3. EVIDENCE
- 4. PROPERTY
- 5. NARRATIVE
- 6. ATTACHMENTS
 - a. Fire Report Mariposa

Incident: 10893 Hwy 140, El Portal, CA 95318

- b. Dispatch Logs = YNP and MMU
- c. YNP Fire Preplan
- d. Assessors Property Info
- e. Project Chronology and Photos by Bill Rust
- f. Sketch of Fire
- g. Photo, Sketch and Log
- h. Statements
- i. Investigator DC7106 Curriculum Vitae

Harold Nolen

Division Chief, #7106

425=08 Date

Incident: MMU#4767, YNP#08-0896

Mariposa County Fire#330, YNP Fire#08-042

April 21, 2008 Structure Fire 'El Portal Market' 10893 Hwy 140, El Portal, CA 95318

SUMMARY:

El Portal Grocery Store, a 2 story, commercial building reported as a structure fire at 05:15, April 21, 2008. Responding units found building fully involved and reported it on the ground shortly thereafter. Mariposa County Fire Investigator was requested at this time.

VICTIMS & WITNESSES

W1, Goodmorning, Sunshine, Female = REPORTING PERSON

W2, Potts, Brad, Male

W3, Carter, Hugh, Male = PREVIOUS TENANT, EL PORTAL MARKET

W4 Rust, Bill, Male

W5, Keheley, Kevin, Male

W6, Johnson, Stewart, Male

W7, Sheetz, Skip, Male

W8, Schoonover, Richard, Male

W9, Falkenstein, Chris, Male

W10, Proflame Propane Co., Joe Lozano

Victim & Wittness page 1 of 2

Harold Nolen

Division Chief, #7106

4-25-08 Date

Incident: MMU#4767, YNP#08-0896

Mariposa County Fire#330, YNP Fire#08-042

April 21, 2008 Structure Fire 'El Portal Market' 10893 Hwy 140, El Portal, CA 95318

V1, Kari, Kristie, Female

V2, U.S. Park Service, Park Superintendent Michael Tollefson, Male

Victim & Wittness page 2 of 2

Harold Nolen

Division Chief #7106

4-25-08 Date

Incident: MMU#4767, YNP#08-0896

Mariposa County Fire#330, YNP Fire#08-042

April 21, 2008 Structure Fire 'El Portal Market' 10893 Hwy 140, El Portal, CA 95318

EVIDENCE

No physical evidence collected. Photo evidence (see Photographic Log).

PROPERTY:

Commercial, 57'x30', 2 story building, known as the El Portal Market and constructed in 1934. Attached to the main structure is a 10'x10' metal refrigeration unit. Three additional storage units: #1 is a 45' truck trailer used to store grocery items, #2 is a 30' truck trailer used to store dry goods and equipment, #3 is a 24' refrigeration unit for storing frozen foods. Radiant heat from the main structure ignited and destroyed all 3 storage units.

NARRATIVE:

On 4-21-08 a commercial structure fire was reported to be at 10893 Hwy 140, El Portal. Upon arrival, units from Yosemite National Park Fire found the building to be fully involved with fire. A Fire Investigator from Mariposa County Fire was called to the scene.

DC7106 arrived at scene at 05:59 and started a preliminary investigation and interviewed victims and witnesses. Pictures of the area were taken by DC7106 as well as Mr. Brad Pott (W2).

It is the opinion of the Investigator after interviewing witnesses and a thorough investigation of the fire scene that the origin of the fire was in the area of the electrical splice box, on the west side of the main structure between the main electrical service drop and the building electrical meters. Electrical wiring arcs in the splice unit indicate the arcing was the ignition source of the fire. The metal splicing unit had holes burnt through the unit and opening into the building. (See photo exhibit # DSCO5336). The building service panels did not trip immediately due to the splice unit placement ahead of the meters and distribution boxes (See exhibit #1A).

Wiring in the building was a mix of 1930 style knob and tube wiring, romax wire and conduit wiring. The main service feed from the weather head to the splice unit and then into 3 power meters from left to right: Meter #1 was disconnected and is believed to have served the old 2nd story apartment which had burnt and was abandoned in 1969; Meter #2 fed a 100 amp service box; Meter #3 fed a 125 amp service box. According to the Building Contractor and Park Electricians, the 125 amp service box was under review for possible replacement due to overloaded conditions and bad wiring. Per Hugh Carter (W3)some breakers in the 125 amp box did not make contact at times causing the overhead lights in the store to go out and arcing in the power box.

The years of extreme weather conditions, age of the building and recent construction activity coupled with the condition of the building wiring aided the quick ignition and destruction of the structure.

Harold Nolen

Devision Chief, #7106

4-25-08 Date

ATTACHMENTS

- a. Fire Report Mariposa Incident: 10893 Hwy 140, El Portal, CA 95318
- b. Dispatch Logs = YNP and MMU
- c. YNP Fire Preplan
- d. Assessors Property Info
- e. Project Chronology and Photos by Bill Rust
- f. Sketch of Fire
- g. Photo, Sketch and Log
- h. Statements
- i. Investigator DC7106 Curriculum Vitae

STRUCTURE FIRE REPO	RT INFORMATION - MA	ARIPOSA COUNTY FIR	EDEP	
Date of Incident: 4-21-08	GENERAL PROPERTY USE	STATISTICS		
ECC #:4967 /NPS 08-089	41 - 1-2 Family Residence	Date	Time	
MPA #: 330 / YNP FIRE 08-0	16 - Restr, food service, bar	Estimate Start 4-21-08	1500	
Fire Name: STORE	42 - Multi-Family dwell		0518	
Incident Address:	47 - Mobile Home Park	First On Scene 4-21-08	0519	
10893 Hwy 140	59 - Business, Office Use	Contained 4-21-08	0630	
EL PURTAL-CA 95318	65 - Farm, Agricultural	Controlled 4-21-08	946	
SITUATION FOUND	80) Storage, Warehouse	End 4-21-08		
1(1)- Structure Fire	Other: POOD STORE	EQUIPMENT TOTAL		
Other:	SPECIFIC PROPERTY USE	MCFD Engines F37		
	411 - 1-2 Family Dwelling	MCFD Trucks		
WEATHER	926 -) Out Bldg, excl garage			
(1)- Clear 2 - Cloudy	815 - Barns, Stables	MCFD Squads		
3 - Rain 4 - Snow	420 - Apartments	MCFD Command C-7100 i	20710	
5 - Hail, Sleet, Ice 6 - Lightning		MCFD Personnel 5	00110	
	STRUCTURE OCCUPIED	Battation Chief # YNB . I	2-211	
FIRST PERSON INVOLVED	1 - Occupied at incident	1 / M P	33 - E	
OC - Occupant TE - Tenant	2.9 Not occupied		-4	
OO - Occup/Owner WD Witness	PROPERTY AND ADDRESS OF THE PARTY OF THE PAR	TYPES OF ACTION TAKE	THE PERSON NAMED IN COLUMN	
PO - Property Owner UN - Unknown		11 - Rescue		
RP - Reporting Party	Under Construction		Overha	
	1	12 - Vent, Extinguish, Salvage, Overhau (13) Extinguish, Salvage, Overhaul		
Name: SINSHINE Good monning. Address:	5 - Not in Use	14 - Salvage & Overhaul	remaul	
State:	5 - Vacant, secured			
	6 - Abandoned, unsecured	15 - Extinguishment		
Zip Code	Other:	1 Investigate		
Telephor	INJURIES	98 - No action taken		
SECOND PERSON INVOLVED	Fire Service:	Other:		
	Non Fire Service:	FORM OF MATERIAL FIRST IC	A STATE OF THE STA	
00 - Occup/Owner Witness	Name (s):	10 - Structural component, Finish		
PO - Property Owner UN - Unknown	· ·	11 - Exterior Roof Covering		
RP - Reporting Party		Exterior Sidewall Cover	ing	
Name: Bard PoTTS	FATALITIES	15 - Interior wall covering		
Address	Fire Service:	16 - Ceiling Covering		
State: .	Non Fire Service:	17 - Structural Member, Fra	ming	
Zip Cod	Name(s):	18 - Insulation		
Геlерha		31 - Mattress, Pillow		
RESPONSIBLE PERSON(S)	METHOD OF EXTINGUISHMENT	76 - Cooking Materials .		
Name: KIRSTIE KARI	1 - Self extinguished	32 - Bedding		
	2 - Garden hose, etc	Certainty: (Certain 2-Alm	ost Cert	
	3 - Portable Extinguisher	3 - Most Probable 4 - Bes	t Estima	
	(5) Water of Apparatus	PROPERTY MANAGEMEN	T	
		GO Private 4 - State		
	Uther -	I II I II I II I I I I I I I I I I I I		
lame: U.S. PARK SOCIETE	Other -			
Name: US PARK SONICE Date of Birth: PMKSex: Supt.	Other -	8 - County Other		

AREA OF ORIGIN IGNITION FACTOR 21 - Sleeping Room 110 - Incendiary, Arson Criminal Act 23 - Dining Area 24 - Kitchen, cooking area 26 - Laundry Room 120 - Intentionally Set, Non Criminal 43 - Supply Storage Room 47 - Garage/Carport 140 - Suspicious 57 - Chimney 74 - Ceiling/Roof 310 - Abandoned Discarded Heat Source Wall Assembly 77 - Exterior roof area 330 - Falling Asleep Other: 350 - Heat source placed too close to combustible EQUIPMENT INVOLVED IN IGNITION 360 - Children Playing with heat source 11 - Central Heating Unit 52 - Drver 460 - Combustible placed too close to heat source 16 - Chimney, Gas Vent Flue 22 - Fixed Stationary Oven 530- Short Circuit, Ground Fault 14 - Indoor Fireplace 31 - Central Air Conditioner 590 - Mechanical Failure 15 - Portable Local Heating Unit Other: Certainty: Certain 2 - Almost Certain 13 - Fixed, Stationary Local Heating Unit 3 - Most Probable 4 - Best Estimate Year: Make: Model: CONTRIBUTING FACTOR (IF ANY) 212 - Careless Act 217 - Misuse of Equipment Serial #: 231 - Drowsiness 241 - Juvenile Activity FORM OF HEAT 242 - Juvenile Left Unattended 23 Equipment Malfunction 32 - Short Circuit from Mechanical Damage 33 - Short circuit from Defective Insulation Other: @8-No system Type of Extinguishment System: 34 Unspecified Short Circuit Arc Wet/dry sprinkler system, Ansul system, Halon 37 - Heat from Overloaded Equipment FLAME DAMAGE 46 - Heat from Properly Operating Elect Equip 47 - Heat from Improperly Operating Elec Equip 1 - Confined to Object of origin 61 - Cigarette 2 - Confined to part of room or area of origin 65 - Match, Lighter 3 - Confined to room of origin Certainty: 17 - Certain 2 - Almost Certain 5 - Confined to story of origin 3 - Most Probable 4 - Best Estimate 6 - Confined to structure of origin Roof Covering: 1 - Tile Compostion Shingle Extended beyond structure of origin 3 - Wood Shakes/Shingles 6 - Metal 7 - Built-up Other: TYPE OF MATERIAL FIRST IGNITED EXTENT OF SMOKE DAMAGE 31- Fat Grease(food) 1 - Confined to object of origin 40 - Plastic 65 Fiberboard, Particle Board 67 - Paper 2 - Confined to part of room or area of origin 72 - Cotton, fabric 3 - Confined to room of origin Other: Certainty: 1- Certain 2- Almost Certain 3- Most Probable 6 - Confined to structure of origin CONSTRUCTION TYPE No damage of this type MATERIAL GENERATING MOST SMOKE 1 - Type I - High fire resistive rating, concrete, min 3 hr rating 2 - Type II - Fire Resistive rating of 2 hrs or less 31 - Fat, grease (food) 40 - Plastic 67 - Paper 3 - Type III - Exterior non/limited combustion-interior combustible Fiberboard, particle board 72 - Cotton, fabric Dollar Damage to Building: 366,000 124,000 UNII 4 - Type IV - Exterior non/limited combustion - interior wood 5 Type V - Exterior and bearing walls, floor roof combustible Dollar Value of Building: 366,000 24,000-DETECTOR SYSTEM TYPE Dollar Damage to Contents: 100,000- 150,000-1 - In room/space of fire origin, alerted occupants Dollar Value of Contents: 100,000- 150,000-NONE 2 - Not in room/space of fire origin, alerted occupants Insurance Company: Non E DETECTOR SYSTEM FAILURE 3 - In room/space of fire origin, did not operate 1 - Power supply (shut off, disconnected, no battery) Not in room/space of fire origin 2 - Improper install or placement of detector 5 - Not in room/space of fire origin 6 - Operated but not a factor in discovery of fire 3 - Defective Detector instrument 7 - Operated but occupants failed to respond 4 - Inadequate maintenance

Consolidated Report



YNP #08-0896 YNP FIRE #08-042

Linked responses by incident or duplicate

Responses							
Date/Time	Agency	Resp.Seq.Num.	Inc:Seq Num: Incident Created	Address	Zone	Resp. Type	Priority Disposition Codes
P 4/21/2008 05:14:20	Yosemite NPS	NPS:2008:04:21:2		EP STORE CI # 896 SFA # 42	ELP99	FIRESTRU	11-FIRE/LE CASE CARD CLEAR CLOSED WITH REPORT FIRE

Caller Information:

SUNSHINE GOODMORNING,

Confidential Information: